



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D350-636-012
Job Sheet 174847



Part No: D350-636-012

Job Qty: 1 ea

Part Name: Skidtube RH, Std Wearplates, DART (Apical) Cylindrical/Aerazur Float Comp.



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 3/22/18

Job Tracking No:

Due Date: 4/24/18

Created By: Michelle Gagnon-Donovan

Type: Stock

Description:

Note: DWG D3492 REV E SHEET 1, D2750-042 REV G SHEETS 1,2,5,9 IPP Rev:I 02.09.25 IPP Rev:J 06-03-23 As per Rev D IPP Rev:K 06-07.13 As per dsi9343 IPP Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM Verf:EC IPP Rev:M 08-04-22 DD verified:EC IPP Rev:N 08-09-23 revF DD verified:ec IPP Rev:O 09-02-06 per PAR09-010 DD verf:EC IPP Rev:P 10.06.22 revise seq110 DD verf:EC IPP Rev:Q 10.10.01 as per IIN revH DDverf:EC IPP REV:R 13.08.27 PER ECN13-594 DD VERF:JLM

Ship Via:

Bill of Materials

DART
AEROSPACE
Container No: S057285
Part: D350-636-012
Job No: 174847
Serial No/Batch: S057285
Revision:
Inspector:
Date: 04/02/18
Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

505728KH

Plex 3/22/18 9:54 AM Dart.Gagnon.Michelle

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		4/23/18	0.00	0.00	Start Up Skid tubes-1		J.Y.
110	Skid tubes	1 pcs		4/23/18	0.00	4.36	Skid tubes-4		BR DAS
120	QC	1 pcs		4/23/18	0.00	0.00	QC10		38 DAS
130	QC	1 pcs		4/23/18	0.00	0.00	QC5		9-89 38
140	HandFinish	1 pcs		4/23/18	0.00	0.91	HandFinish1		SA 18-04-03
150	QC	1 pcs		4/23/18	0.00	0.00	QC7-2		BR DAS J.Y.
160	Skid tubes	1 pcs		4/23/18	0.00	4.36	Skid tubes-1		38 DAS
170	QC	1 pcs		4/23/18	0.00	0.00	QC10		9-89 38
180	QC	1 pcs		4/23/18	0.00	0.00	QC5		38
190	HandFinish	1 pcs		4/23/18	0.00	0.91	HandFinish2		SA 18-04-06
200	Spray Paint	1 pcs		4/23/18	0.00	0.69	Spray Paint		
205	Outsource	1 pcs		4/23/18			ATE003-VC	PO 39531	CA 18/04/06
210	QC	1 pcs		4/23/18	0.00	0.00	QC14		18-4-15
230	HandFinish	1 pcs		4/24/18	0.00	0.91	HandFinish4		DAS 18-4-11
240	QC	1 pcs		4/24/18	0.00	0.00	QC5		38
250	Packaging	1 pcs		4/24/18	0.00	0.00	Packaging1-3		DAS 9-89
260	QC	1 pcs		4/24/18	0.00	0.00	QC4		6 DAS 19 2018
265	DC	1 pcs		4/24/18	0.00	0.00	DC		9-89 58
270	Packaging	1 pcs		4/24/18	0.00	0.00	Packaging3-1		DAS
280	QC21-FG	1 Ea		4/24/18	0.00	0.00	QC21-FG	8/18/04/23	58 APR 23 2018

Part Op 110 - 1- Pick D2600-3 Bent Drill pilot holes as per Dwg D2750 sheet 4 (D2750-2 details). Drill using drill bit DT8150 & Descriptions: DT8863A for second side only DT8863B for first side (detail K) 4- Locate DT8329 off of blade fitting bolt holes and drill pilot holes for blade fitting. Open to 0.500" using hole saw. VERIFY AND RECORD FWD BEND ANGLE. 6- Drill pilot holes for wearplates as per Dwg D2750 using DT8108 open to 0.297". 7- Open up holes of Detail J to 0.297" (total of 2 holes per side) 8- Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004 9- Grind welds flush as per Dwg D2750

160 - 1- Open up holes of Detail L using hole saw and ground handling to 0.625" (total of 8 holes per side) as per dwg D2750. 2- Open up holes of Detail K using hole saw to 0.750" (total of 4 holes per side) as per dwg D2750. 3- Open float holes using uni-bit to .500" (4 per Side) 4- Chamfer holes of Detail K, L, ground handling and float holes per dwg D2750 (welding instructions on sheet 9) 5- Deburr and blow out all chips from inside of tube 6- Prepare tube for welding, remove alodine as required. 7- Bond web D2739 in place as per QSI 015, let cure for 12hrs. A/R Sikaflex-291 batch: 138654 exp. date: 2018-04-21 ***ATTN: USE I-BEAM LOCATION AID (BLADE FITTING)*** 8- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004 (welding instructions on sheet 9) A/R Aluminum Rod batch: 038611 9- At section AP-AP drill out x-bolt spacer to 0.404" 10-Grind welds flush as per Dwg D2750 11- Spot face ground handling holes section (total of 4 places per side) as per dwg D2750 12- Deburr holes, ensure tube is free of all scratches before sending to paint.

180 - ***VERIFY C'BOARD IS GOOD***

190 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.

200 - 1- PRIME AS PER DWG AND QSI 005 4.2 PRIMER PRC DESOTO 515X349 BATCH: _____ 2-

PAINT WHITE AS PER DWG AND QSI 005 4.2 PAINT BATCH: _____

210 - Inspect for foreign object per QSI 024

230 - 1-Install inserts as per dwg D2750 2-Inspect for Foreign Objects 3-Install blade fitting D3488-042, wearshoes and ground handling hardware as per dwg D2750 SIKA FLEX 241 BATCH: M136487 EXP DATE: 1810 4- assemble o-ring to plug as per dwg D3492 and apply o-ring lube A/R 55-o-ring lube batch: M135572 5-Coat all exposed fasteners with "LPS Procyon" batch: M133690

265 - record fwd angle: 29.8 Photocopy blue file and type labels per PPP D350-636-012 CHG 007

270 - Package as per PPP D350-636-012

Job BOM					002411
Part / Item	Component Name	Quantity	Operation	Container	
D2600-3-BENT-RH	Extrusion Bent RH	1 Ea (1 ea)	90-Start up Operation	5043018	
D2744	Cap	1 Ea (1 ea)	90-Start up Operation	5038835	
D2739	350 I-Beam	1 Ea (1 ea)	160-Skidtubes	5040982	
D2743	Crossbolt Spacer	8 Ea (8 ea)	160-Skidtubes	5000649	
D3490-1	Cross Bolt Spacer	4 Ea (4 ea)	160-Skidtubes	5039269	
D3490-3	Cross Bolt Spacer	4 Ea (4 ea)	160-Skidtubes	5040318	
ALS4-1032-225	Rivnut	38 Ea (38 ea)	230-HandFinish	5034386	
AN3C5A	Bolt	34 Ea (34 ea)	230-HandFinish	5053153	
AN3C6A	Bolt	4 Ea (4 ea)	230-HandFinish	5019397	
AN6C44A	Bolt	4 Ea (4 ea)	230-HandFinish	FM137055	
AN8C35A	Bolt	1 Ea (1 ea)	230-HandFinish	FM137203	
D2745	Bushing	8 Ea (8 ea)	230-HandFinish	5053257	
D3488-042	Blade Fitting RH	1 Ea (1 ea)	230-HandFinish	5007389	
D3492-1	Plug	8 Ea (8 ea)	230-HandFinish	5044324	
D3492-3	Plug	8 Ea (8 ea)	230-HandFinish	5053031	
D3535-25	Wearplate Center	1 Ea (1 ea)	230-HandFinish	5047172	
D3536-25	Gasket Center	1 Ea (1 ea)	230-HandFinish	5047737	
D3537-1	Wearpad	3 Ea (3 ea)	230-HandFinish	5037408	
D3631-1	Washer	8 Ea (8 ea)	230-HandFinish	5058407	
D3791-1	Wearpad	1 Ea (1 ea)	230-HandFinish	5049290	
D3793-1	Wearplate Fwd	1 Ea (1 ea)	230-HandFinish	5047586	
D3793-3	Wearplate Aft	1 Ea (1 ea)	230-HandFinish	5041206	
D3794-1	Gasket Fwd	1 Ea (1 ea)	230-HandFinish	5046363	
D3794-3	Gasket Aft	1 Ea (1 ea)	230-HandFinish	5046244	
MS21043-6	Nut	4 Ea (4 ea)	230-HandFinish	5053037	
MS21083C8	Nut	1 Ea (1 ea)	230-HandFinish	5034401	
NAS1149C0332R	Washer	38 Ea (38 ea)	230-HandFinish	5041236	
NAS1149C0832R	Washer	1 Ea (1 ea)	230-HandFinish	M138409-121	
NAS1515H3L	Washer	4 Ea (4 ea)	230-HandFinish	5036714	
NAS1611-010	O-Ring	8 Ea (8 ea)	230-HandFinish	502298	
NAS1611-013	O-Ring	8 Ea (8 ea)	230-HandFinish	M138441-122	
AN8C21A	Bolt	2 Ea (2 ea)	250-Packaging	FM137162	
D2741	Replacement Blade	1 Ea (1 ea)	250-Packaging	5052857	
D3493-1	Washer	2 Ea (2 ea)	250-Packaging	5040443	
D3532-1	Spacer	2 Ea (2 ea)	250-Packaging	5016888	
MS21083C8	Nut	2 Ea (2 ea)	250-Packaging	F125633	
NAS1149D0863J	Washer	2 Ea (2 ea)	250-Packaging		

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D2600-3-BENT-RH	1	8	0
	D2744	1	15	0
160-Skidtubes	D2739	1	25	0
	D2743	8	201	0
	D3490-1	4	64	0
	D3490-3	4	47	0
230-HandFinish	ALS4-1032-225	38	1,149	0
	AN3C5A	34	191	0
	AN3C6A	4	330	0
	AN6C44A	4	407	0
	AN8C35A	1	63	0
	D2745	8	225	0
	D3488-042	1	7	0
	D3492-1	8	211	0
	D3492-3	8	144	0
	D3535-25	1	20	0
	D3536-25	1	34	0
	D3537-1	3	153	0
	D3631-1	8	59	0
	D3791-1	1	16	0
	D3793-1	1	20	0
	D3793-3	1	28	0
	D3794-1	1	16	0
	D3794-3	1	44	0
	MS21043-6	4	182	0
	MS21083C8	1	169	0
	NAS1149C0332R	38	4,898	0
	NAS1149C0832R	1	88	0
	NAS1515H3L	4	255	0
	NAS1611-010	8	389	0
	NAS1611-013	8	285	0
250-Packaging	AN8C21A	2	141	0
	D2741	1	67	0
	D3493-1	2	60	0
	D3532-1	2	38	0
	MS21083C8	2	169	0
	NAS1149D0863J	2	147	0

Part Specifications

Specifications could not be found.

Plex 3/22/18 9:54 AM Dart.Gagnon.Michelle

QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D2750-041	350 SKIDTUBE ASSEMBLY, LH
	X			D2750-042	350 SKIDTUBE ASSEMBLY, RH
		X		D2750-043	350 SKIDTUBE ASSEMBLY, LH
			X	D2750-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3536-25	GASKET
3	3	3	3	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
38	38	38	38	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
34	34	34	34	AN3C5A	BOLT
4	4	4	4	AN3C8A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
38	38	38	38	AN960C10L	WASHER
1	1	1	1	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER

GENERAL NOTES:

- MATERIAL: MAKE D2750-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- FINISH: ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
STANDARD: PRIME (REF. 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2
OPTIONAL: POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED
- BREAK SHARP EDGES: N/A
- IDENTIFICATION: N/A
- WEIGHT: D2750-041/-042/-043/-044 = 26.5 LBS
- WELD PER DART QSI 004
- INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED. DRILL 'F' SIZE HOLES (Ø0.297) FOR WEARSHOE INSERTS
- FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF
FINISH WITH MEK DEGREASER.
- SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 174847
MAR 22 2018

RELEASED
2013-08-13

G	CORRECTED TOLERANCE ON Ø0.500 THRU HOLE: IS +0.010/-0.000, WAS +0.100/-0.000 (ZN B3-4, B2-5); ADD VIEW TO CONTROL FWD BEND ORIENTATION (ZN D-1/-4/-5/-6/-7); UPDATED FINISH OPTIONS; INSIDE OF TUBE NO LONGER SPRAYED WITH LPS-3. REASON: PARTS-276 AND NCR13-2757	MB	13.07.11
F	INCORPORATE DSI 9413. QTY (3) D3537-1 WAS QTY (5) (ZN C8-1); D3791-1/-3 REPLACES D3535-13/-35 (ZN C8-1); D3794-1/-3 REPLACES D3536-13/-35 (ZN B8-1); ADD D3791-1 (ZN C8-1); WEARSHOE HOLES UNDER FWDRAFT SADDLE REMOVED (R PL). WEARSHOE HARDWARE QTY UPDATED (ZN B8-1); D3488-041/-042 HARDWARE UPDATED (ZN C1-8, 9, 10, 11); ADD NOTE 12 AND 13 (ZN A6-1); REASON: REF. NCR 08-043	PH	08.07.16
E	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY (38) NAS1515H3L; REMOVE QTY (10) NAS1515H8L; REMOVE D2741, QTY (2) AN960C816; REMOVE QTY (2) MS21083C8	CB	07.05.17
D	ADD HOLES AND SPACERS FOR APICAL FLOATS; INCORPORATE DEC 9133/9157	PH	06.01.05
C	ADD D2750-3/D2750-4; INCORPORATE D2738 AND D2740	CP	06.11.18
B	CHANGE MS24694-S263 TO AN6-16A	CP	06.09.01
A	NEW ISSUE	DS	06.04.16
REV.	DESCRIPTION	BY	DATE
DESIGN	MM		
DRAWN	B		
CHECKED	JP		
MFG. APPR.	JP		
APPROVED	JP		
DE APPR.	JP		
DATE	13.07.11		

DART AEROSPACE USA, INC.

KENT, WA

DRAWING NO.

D2750

TITLE

350 SKIDTUBE ASSEMBLY

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS UNCLASSIFIED AND CONTAINS NO INFORMATION OF A NATURE THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.

REV. G

SHEET 1 OF 11


SCALE

NTS

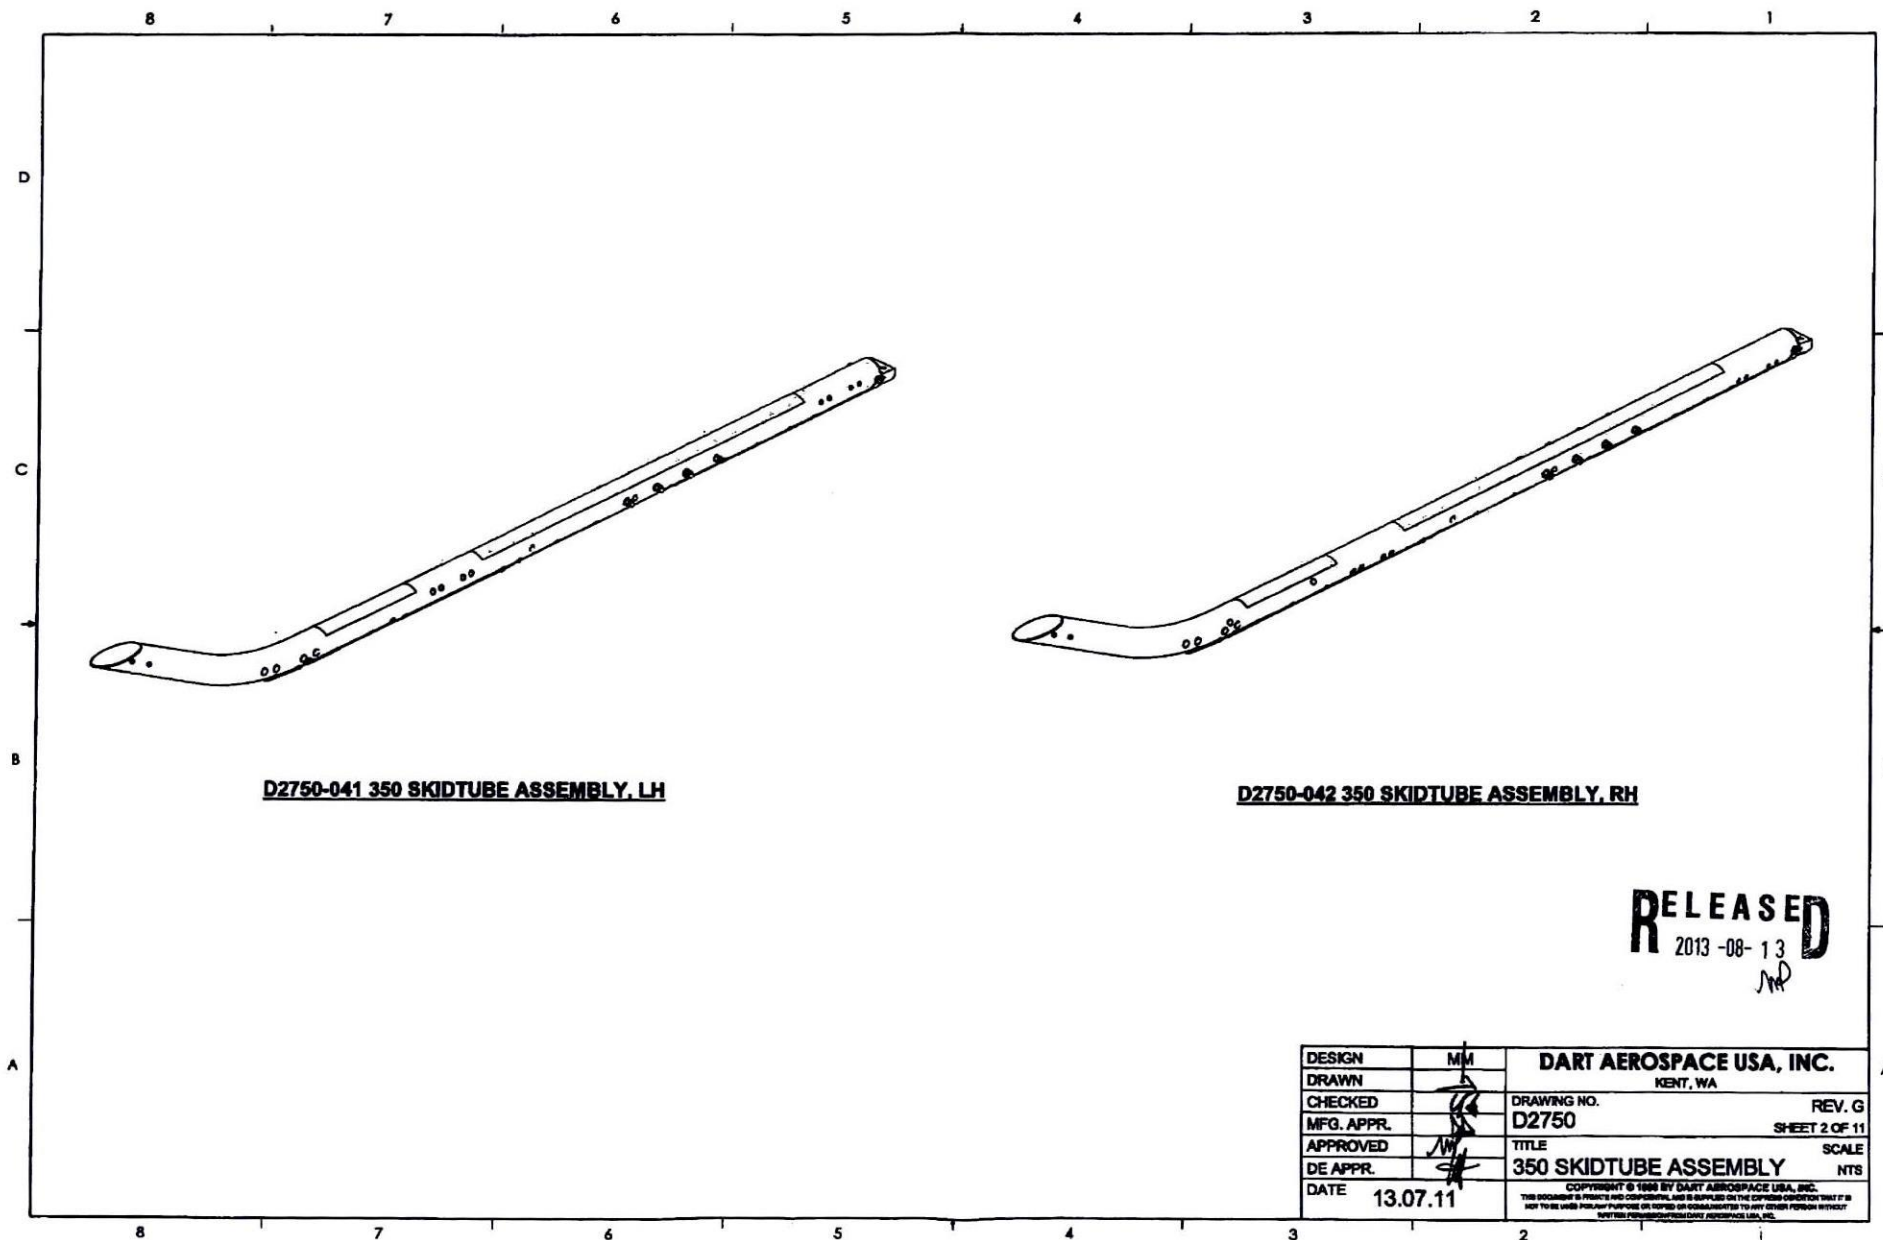

RELEASED
2013-08-13
MD

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN	<i>[Signature]</i>	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D2750	REV. G
MFG. APPR.	<i>[Signature]</i>	SHEET 2 OF 11	
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1999 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR REPRODUCED IN ANY FORM WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

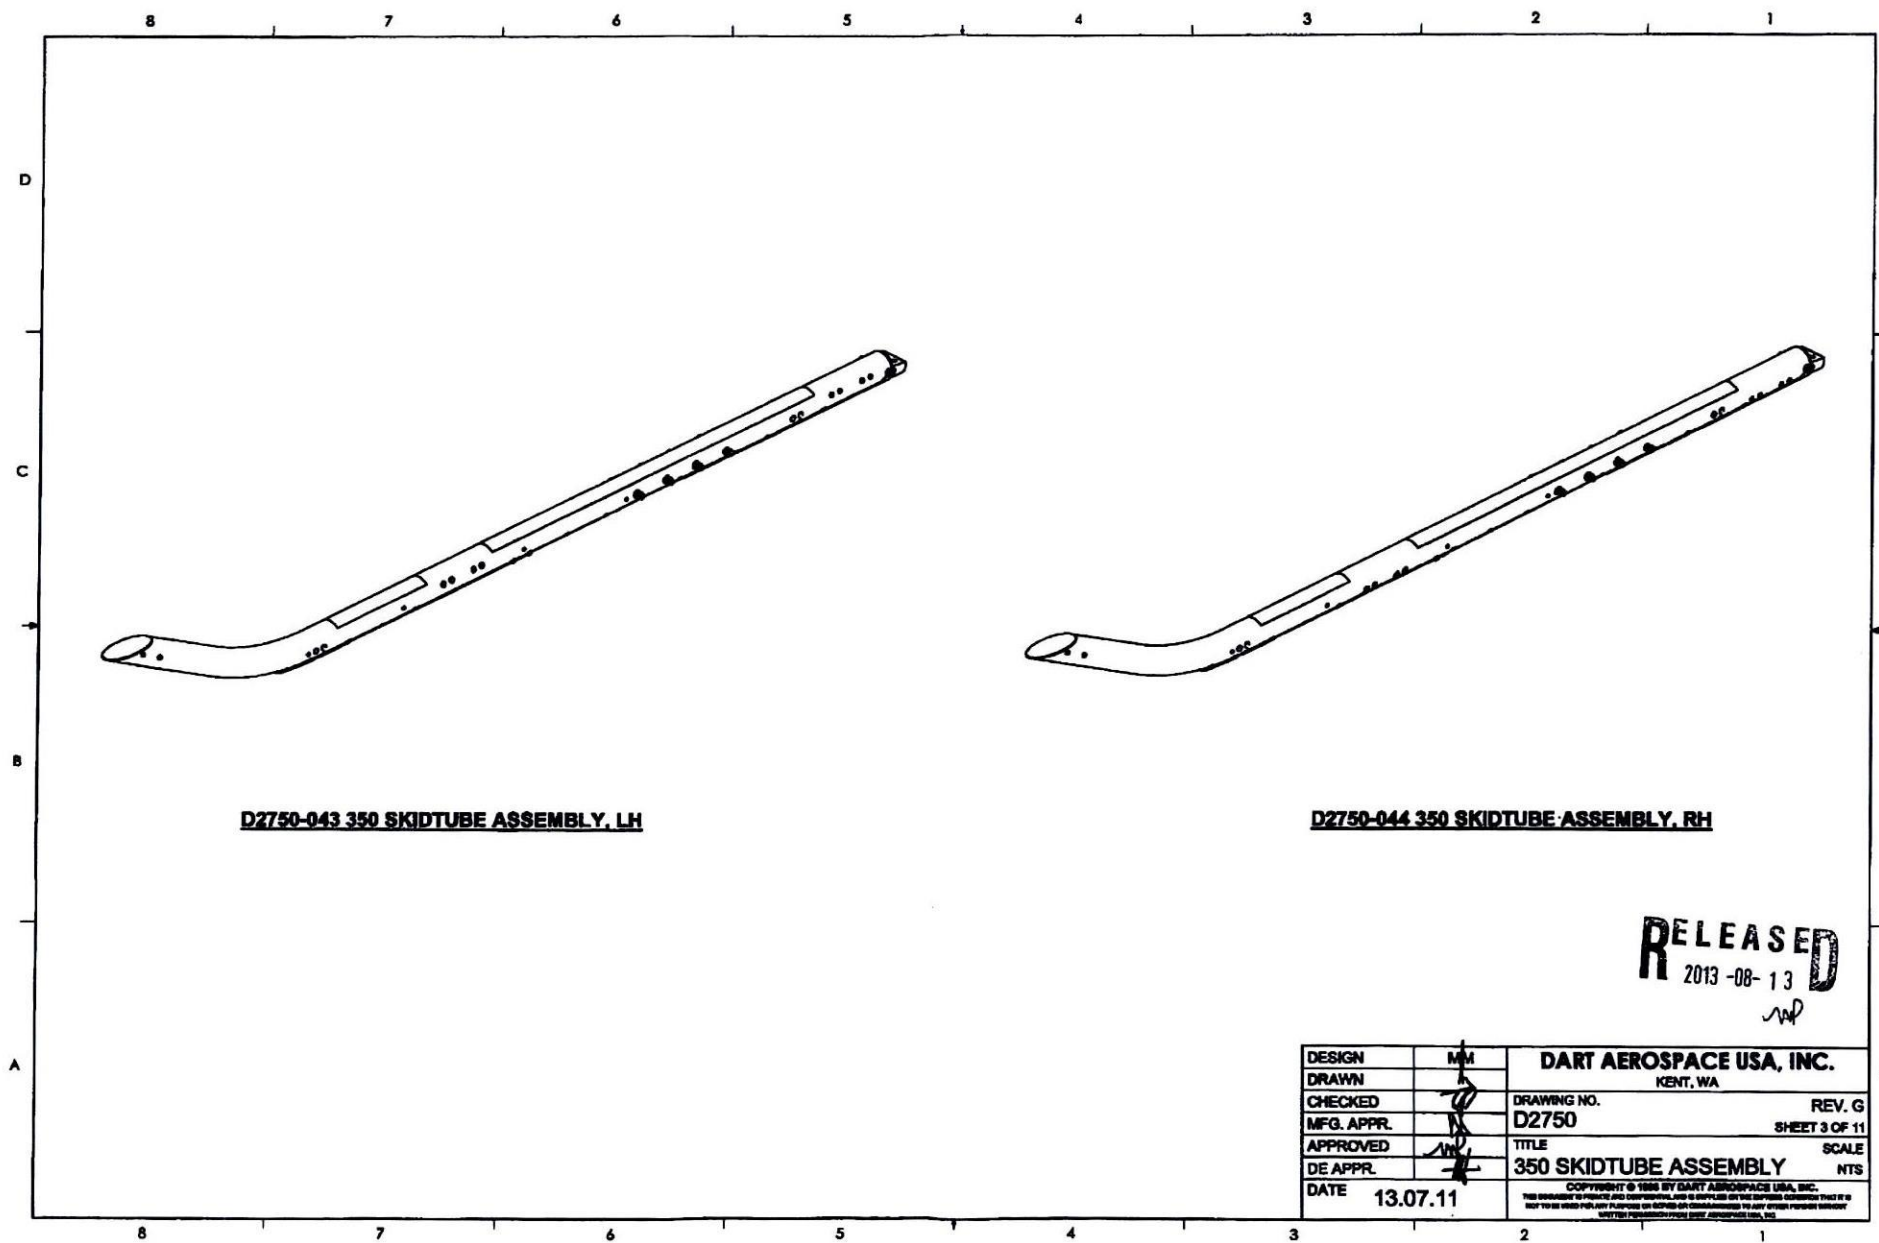










D2750-043 350 SKIDTUBE ASSEMBLY, LH

D2750-044 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2013-08-13
NAD

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO. D2750	REV. G
MFG. APPR.		SHEET 3 OF 11	
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1986 BY DART AEROSPACE USA, INC. THIS DRAWING IS THE PROPERTY OF DART AEROSPACE USA, INC. AND IS NOT TO BE USED FOR ANY PURPOSES OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	



RECEIVED
2013-08-13

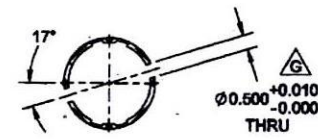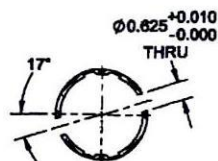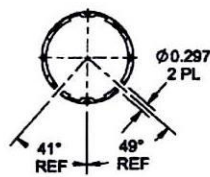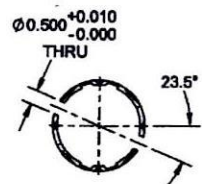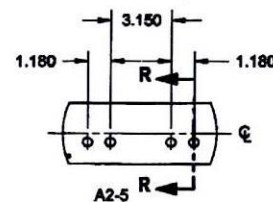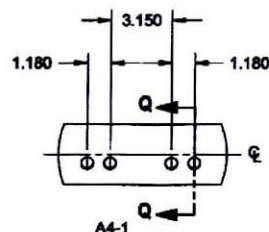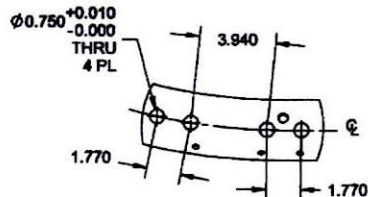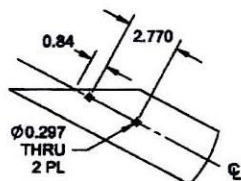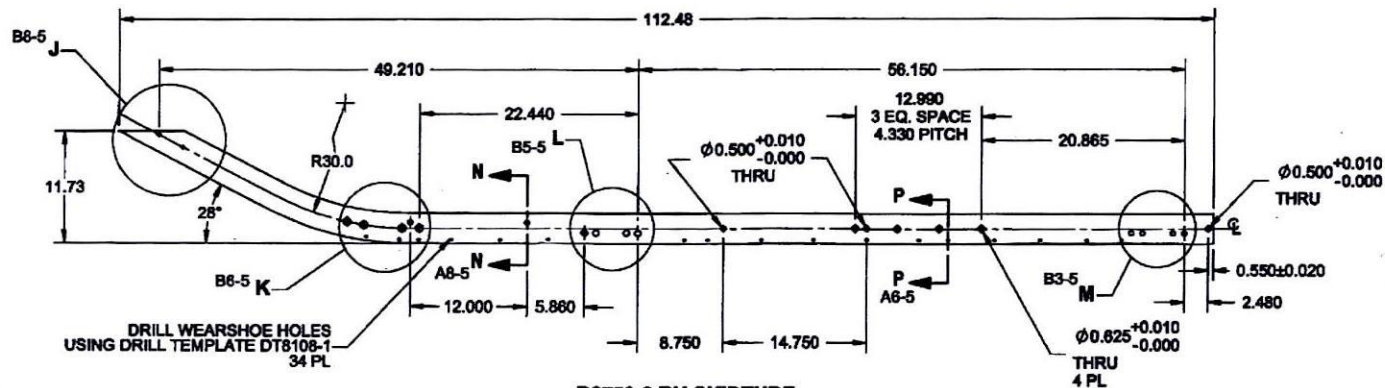

RELEASED
2013-08-13


DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO. D2750	REV. G
MFG. APPR.		SHEET 5 OF 11	
APPROVED		TITLE 350 SKIDTUBE ASSEMBLY	
DE APPR.		SCALE NTS	
DATE	13.07.11	COPYRIGHT © 1999 BY DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

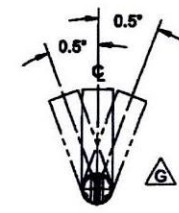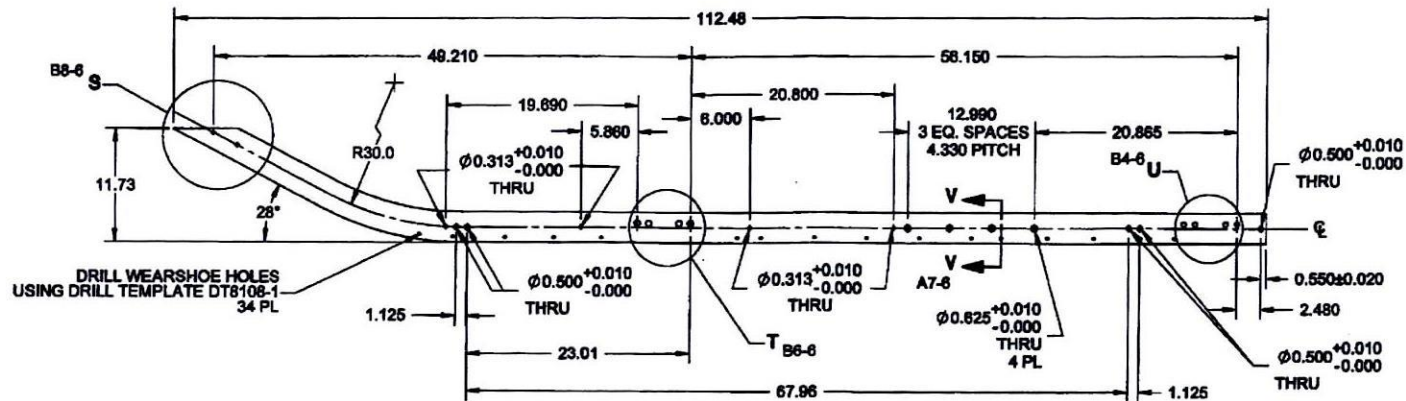


OUTBD
MAX ALLOWABLE
TWIST ON FWD BEND
(VIEWED LOOKING FWD)


D2750-3 LH SKIDTUBE

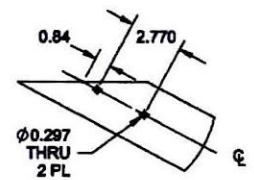


DETAIL S
SCALE 2X
D8-6

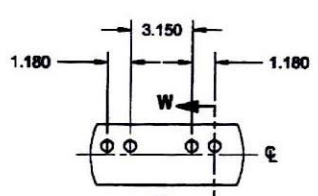


DETAIL T
SCALE 2X
C5-6
A5-6 W

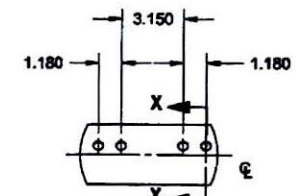


DETAIL U
SCALE 2X
D3-6
A3-6 X

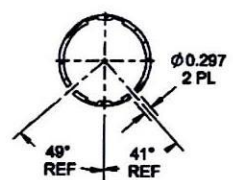

SECTION V-V
SCALE 3X, 17 PL
C4-6

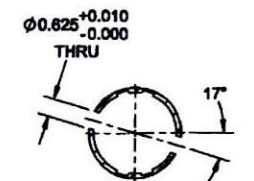

SECTION W-W
SCALE 3X, 4 PL
B8-6

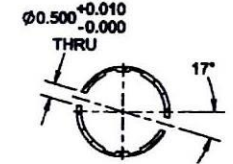


SECTION X-X
SCALE 3X, 4 PL
B4-6


RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D2750	SHEET 8 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 1986 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PROPERTY AND CONFIDENTIAL, AND IS LOANED TO THE USER UNDER THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OTHER THAN FOR WHICH IT WAS LOANED. IT IS TO BE RETURNED TO DART AEROSPACE USA, INC. UPON COMPLETION OF THE PROJECT.	


8 7 6 5 4 3 2 1

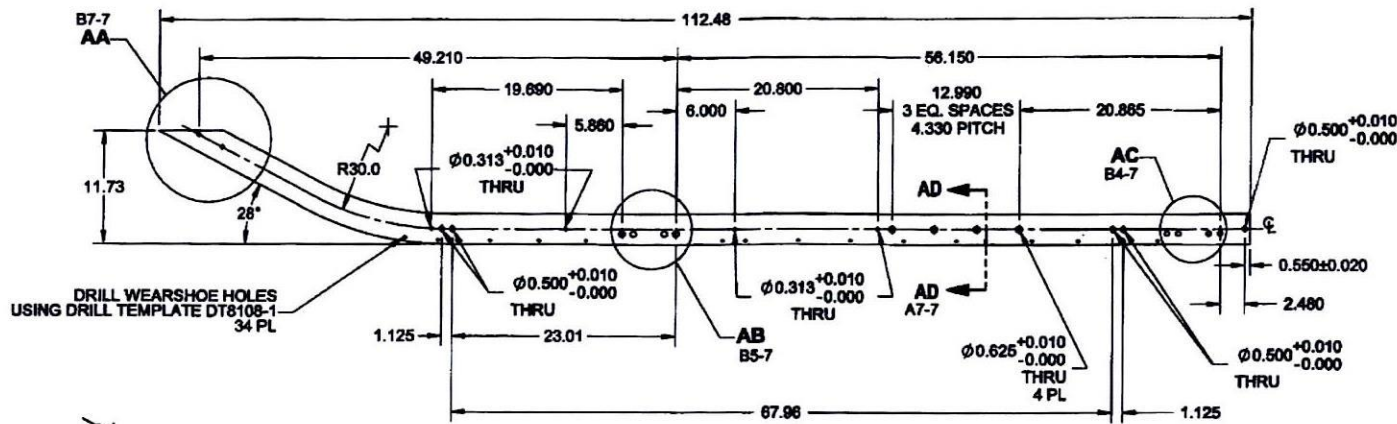


D2750-4 RH SKIDTUBE

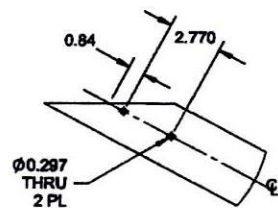


DETAIL AA
D7-7
SCALE 2X

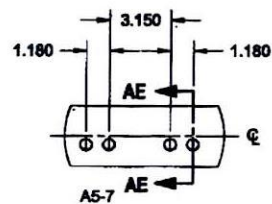


DETAIL AB
C4-7
SCALE 2X

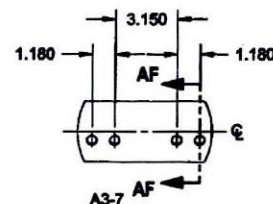


DETAIL AC
D3-7
SCALE 2X

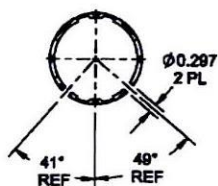

SECTION AD-AD
D3-7
SCALE 3X, 17 PL

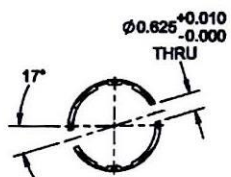

SECTION AE-AE
B8-7
SCALE 3X, 4 PL

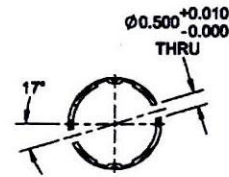



SECTION AF-AF
B4-7
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN	MM	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO. D2750	REV. G
MFG. APPR.		SHEET 7 OF 11	
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	
DATE	13.07.11	NTS	

COPYRIGHT © 1988 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE TO THE PUBLIC. IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.

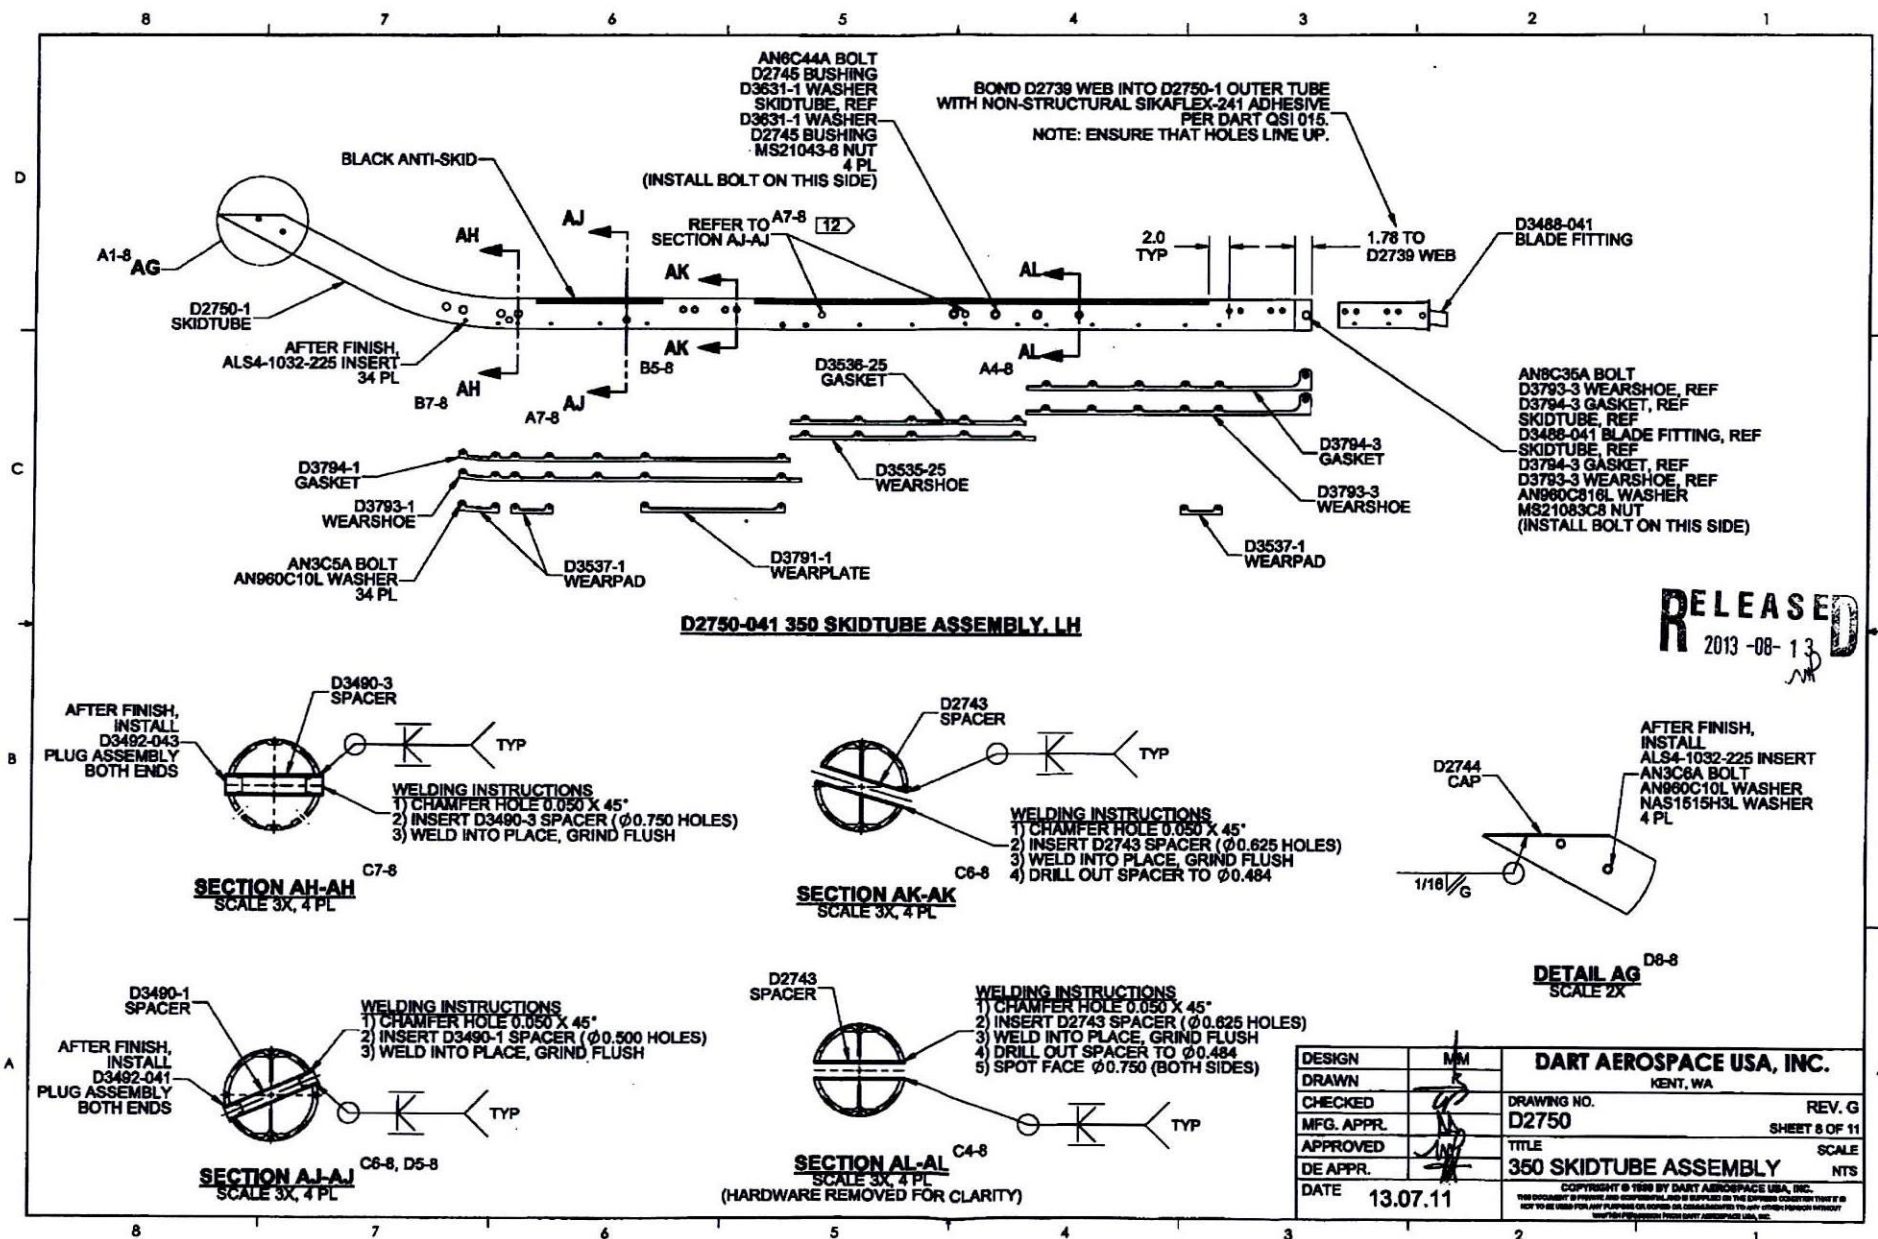

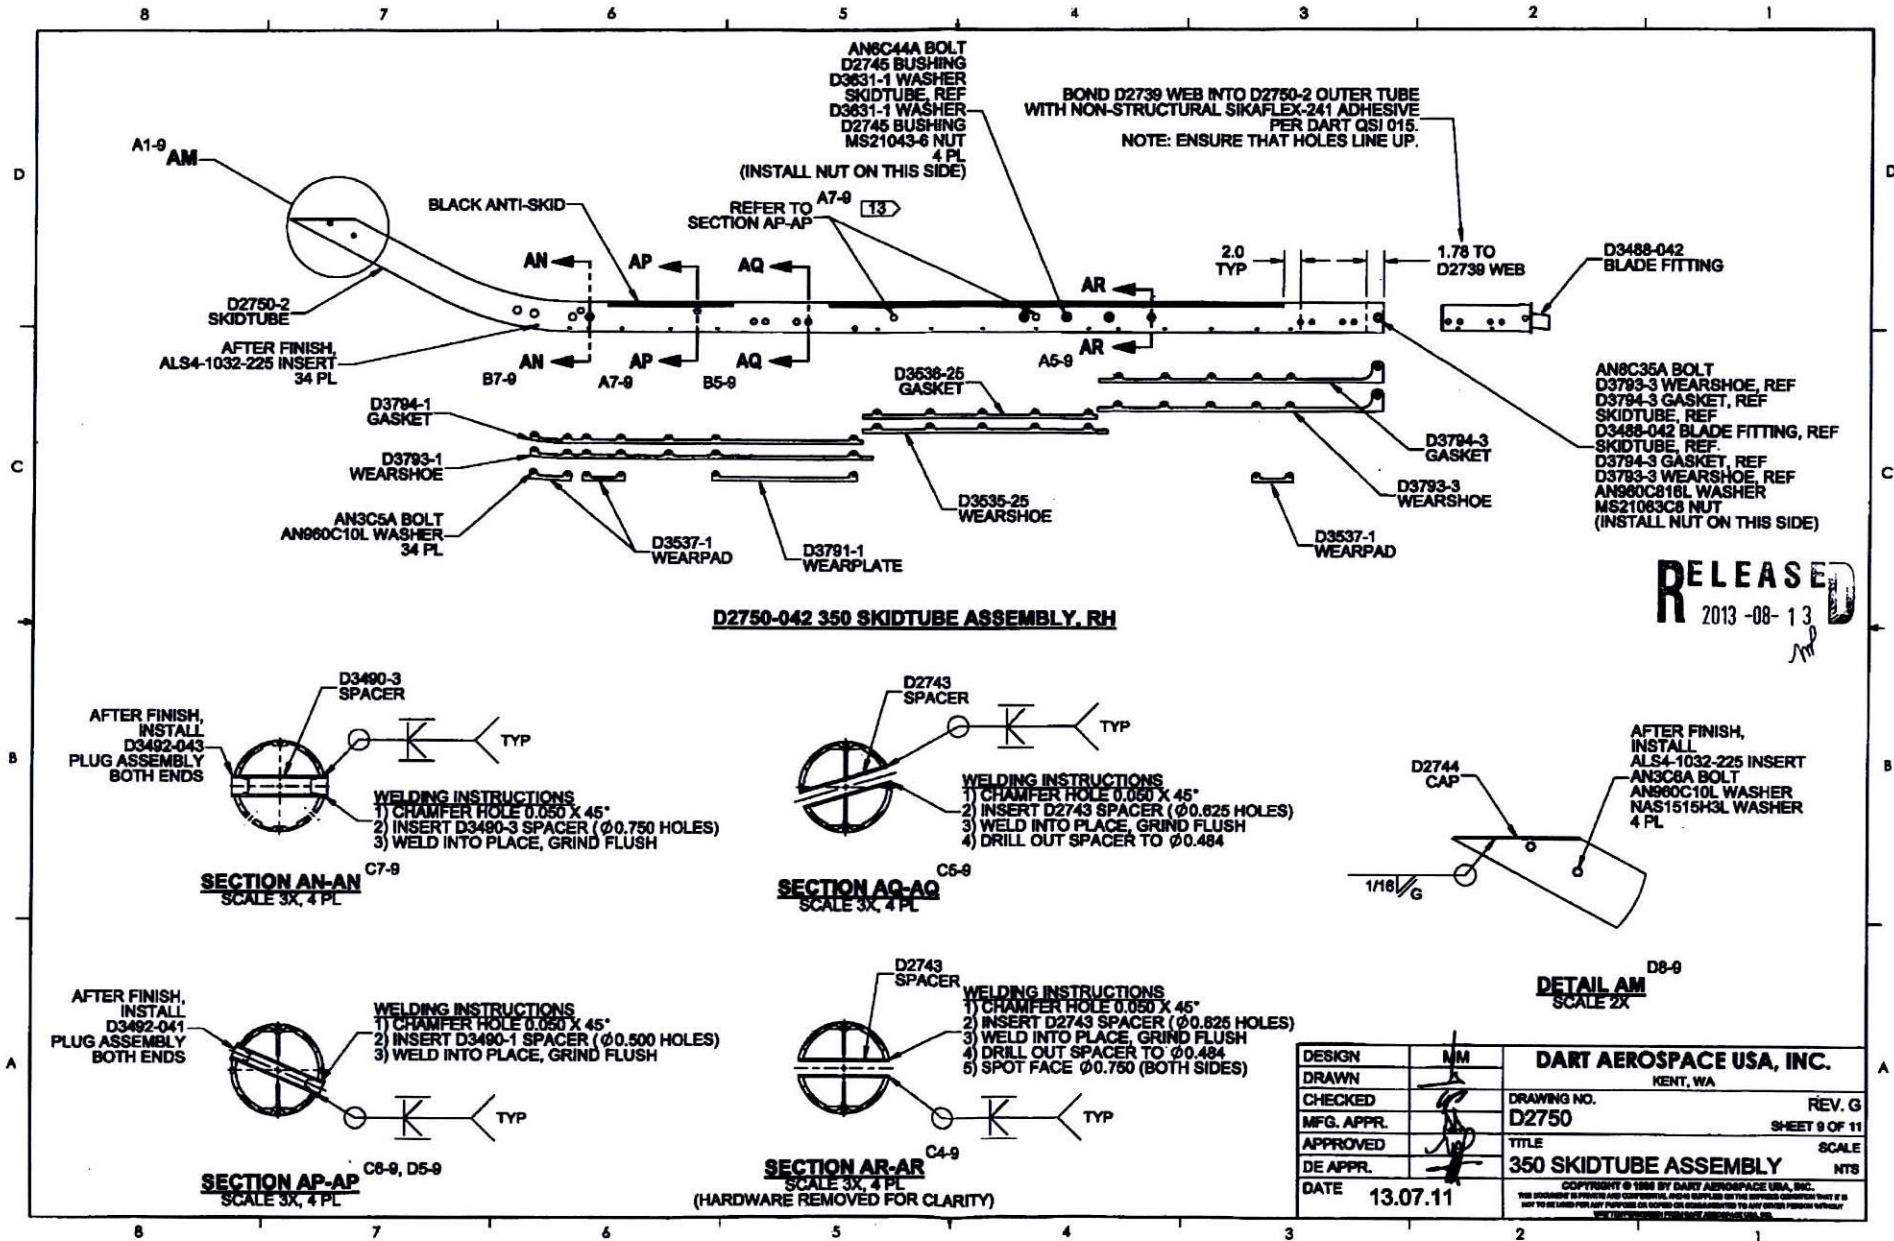



Traveller Change Request

Part#: D350-636-012

Job#: 174847

Name JESSE

Date 18-04-02

Workcenter Startup

Operation # 90

Issue: Quality ☐

Wrong Routing ☐

Op Description ☐

Missing Information ☐

Material ☒

Other ☐

DAS
10
9-89

Change requested: D2744 Should Be on op 110

Name _____

Date _____

Workcenter | _____ |

Operation # _____

Issue: Quality ☐

Wrong Routing ☐

Op Description ☐

Missing Information ☐

Material ☐

Other ☐

Name _____

Date _____

Workcenter _____

Operation # _____

Issue: Quality ☐

Wrong Routing ☐

Op Description ☐

Missing Information ☐

Material ☐

Other ☐

Change requested: _____

7

PAGE 1 OF 1

Part Number: D350-636-011/-011GB/-012/-012GB

Description: SKIDTUBE STD LH/RH, FLOAT COMPATIBLE

[illegible]

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					